

LOGSTOR HBX

Installation Instructions - Industry





HBX


High temperature straight joint, double sealed

Fitting Instructions


1/2

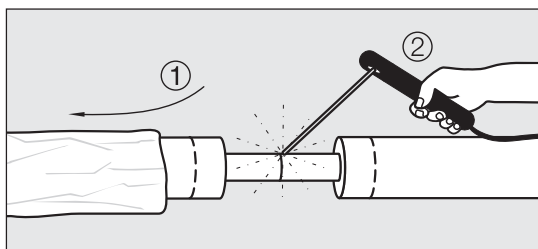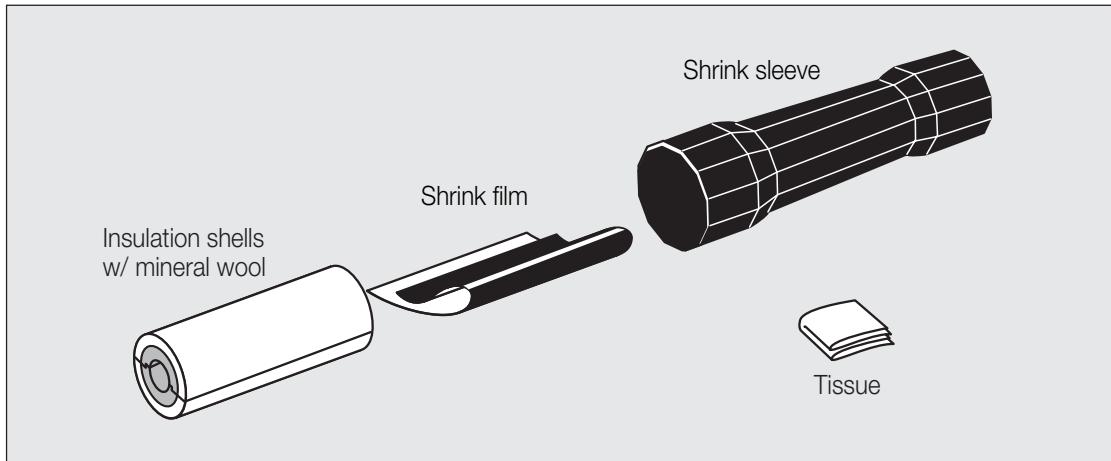


1. Place the shrink sleeve with packing on one of the pipes, before the carrier pipes are joined.

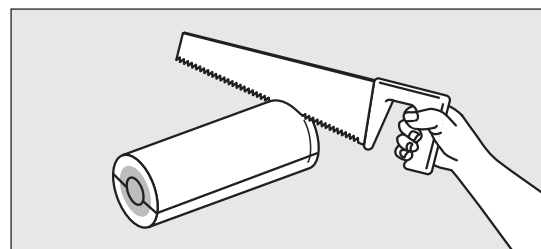


3. Shorten the insulation shells to make them fit tightly between the jacket pipes.

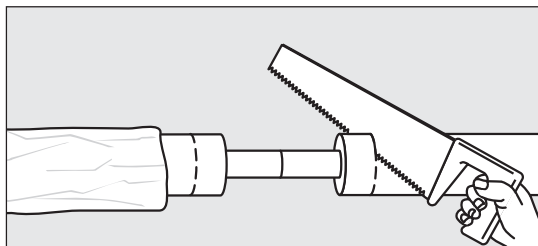


2. Cut the jacket pipes at the markings.

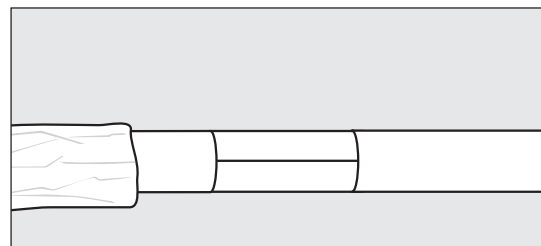

5. Fit the insulation shells tightly between the jacket pipes, using adhesive tape if required. The surfaces must be CLEAN and DRY.

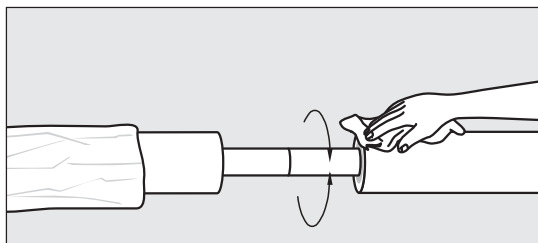

3. Clean all surfaces in the mounting area.

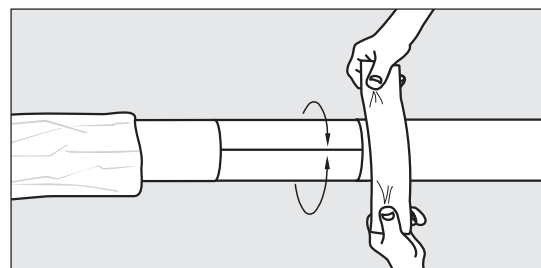


6. Activate the jacket pipes with abrasive cloth grain size 80 at least 150 mm from both jacket ends.

HBX


High temperature straight joint, double sealed

Fitting Instructions


2/2

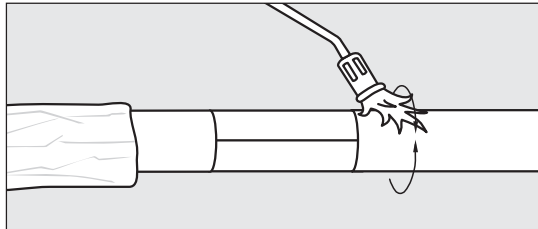


7. Activate the jacket pipes with a gas burner at least 150 mm from both jacket ends, until the surface has a matt, silky look.

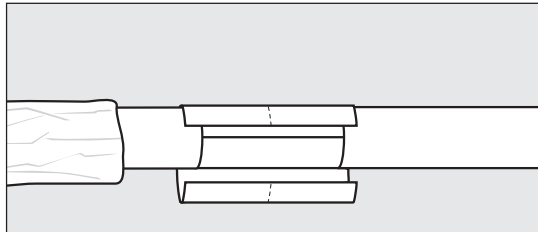


8. Place the shrink film so that the marking line encircles the pipe. Attach one edge of the shrink film at "10 o'clock" position. Pull the film around the pipe by removing the adhesive paper so that the film adheres to the surface beneath.

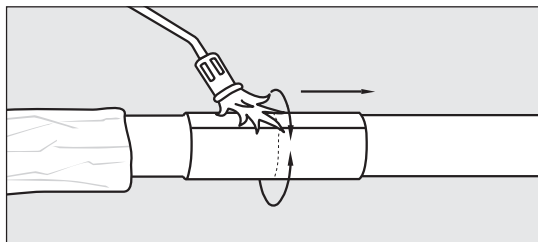


9. Heat the whole film from the centre outwards, ensuring that the mastic becomes visible at all edges and that the shrink film is tightly fitted.

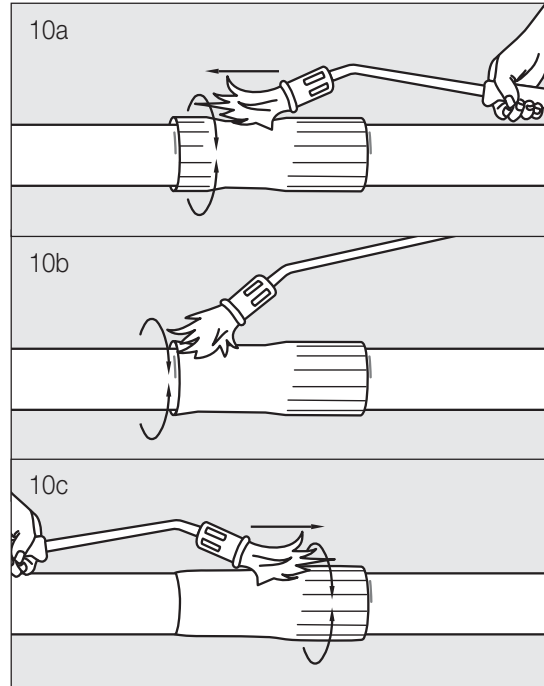

10. Remove the packing from the shrink sleeve. Check that the sleeve is CLEAN and DRY, inside and out. Centre the shrink sleeve on the joint and mark it. First, shrink from the middle towards one end, then from the middle towards the other end. Avoid heating directly on the jacket.

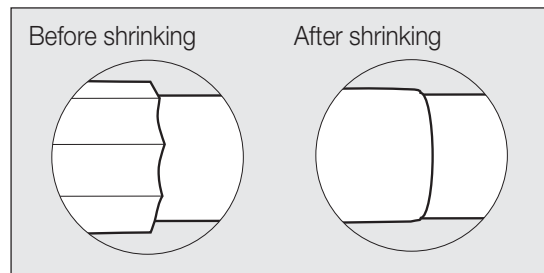

11. Shrink until all expansion marks have vanished and the ends of the sleeve form a smooth encircling edge.

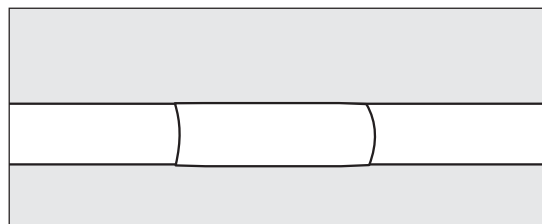

12. The joint is complete.

Contact details

Denmark

LOGSTOR Denmark Holding ApS
Danmarksvej 11 | DK-9670 Løgstør

T: +45 99 66 10 00
E: logstor@kingspan.com



For the product offering in other markets please contact your local sales representative or visit www.logstor.com

Care has been taken to ensure that the contents of this publication are accurate, but Kingspan Limited and its subsidiary companies do not accept responsibility for errors or for information that is found to be misleading. Suggestions for, or description of, the end use or application of products or methods of working are for information only and Kingspan Limited and its subsidiaries accept no liability in respect thereof.

To ensure you are viewing the most recent and accurate product information, please scan the QR code directly above.

